



Details	Information
Name of the Mine	Hutti Gold Mine
Owner of the Mine	M/s Hutti Gold Mines Company Limited
Date and time of accident	On 30.10.2019 at about 19:10 hrs
Number of Persons killed	Nil
Number of persons seriously injured	01 (One)
Photographs (maximum 02 numbers)	<div style="display: flex; justify-content: space-around;">   </div> <p data-bbox="571 1115 906 1267">Picture. 01: Damaged flange, lock ring and wheel of the LHD</p> <p data-bbox="991 1115 1362 1267">Picture 02: worn out locking rim and bead seat area of the rim.</p>
Prima facie cause of the accident	<p data-bbox="555 1290 1407 1850">While inserting the wheel and aligning the holes of a reconditioned rim of a wheel onto the newly installed studs, in the front left axle hub of an electrically operated LHD, by a crew consisting of one Foreman and four Workmen, in an underground metal mine, one of the Workmen tapped the reconditioned multi-piece wheel rim of the wheel, three times, in between the wheel studs, with a result the lock ring of the wheel popped off from the bead seat area of the rim, inflicting serious bodily injuries to the Workmen, who was positioned in front of the rim</p>