



भारत सरकार श्रम एंव रोजगार मंत्रालय खान सुरक्षा महाननदेशालय




SAFETY ALERT: 30

Dhanbad, dated

04/12/2025.

Subject: Fatal accident occurred due to Hit by Rock Breaker Machine on forehead at Dudhichua Opencast Project of M/s Northern Coalfields Limited.

1.	Name of Mine	:	Dudhichua OCP			
2.	Name of Owner	••	M/s Northern Coalfields Limited			
	District	••	Sonebhadra			
	State	••	Uttar Pradesh			
3.	Mineral	••	Coal			
4.	Date and time of accident		17/11/2025, 01:30 PM			
5.	Place of accident		Crusher no 03, CHP			
6.	Killed	••	Name: Ram Sajivan Vaishya Designation: Fitter Age: 52 Years Experience: Not Available.			
7.	Seriously Injured	••	Nil			
8.	Brief Cause	••	"While clearing the jammed hopper of the No.3 crusher in CHP by Back Hoe, the boom of the Back Hoe collided with the boom of the breakdown rock breaker, consequently, the rock breaker arm moved and allegedly hit on the forehead of Sri Ram Sajivan Vaishya, Fitter, who was standing near the breakdown rock breaker's arm, causing fatal injuries to him. He was immediately shifted to NSC hospital where he was declared brought dead."			
9.	Sketch showing the accident:					

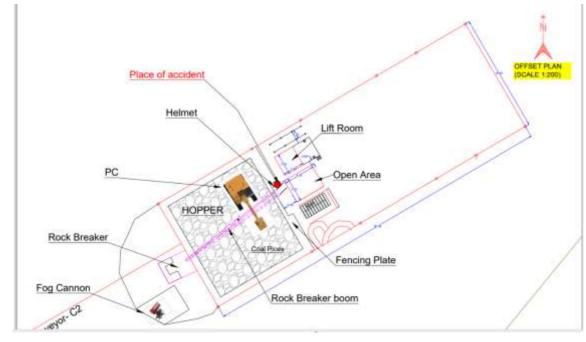

0	Apply	LOTO	to all	relevan	t electrica	and	hydraul	ic systems.
---	-------	------	--------	---------	-------------	-----	---------	-------------

Ensure rock breaker arm is fully retracted, parked, lowered, and locked before allowing any person or equipment in the area.

Safe Positioning of Ground Personnel

- No person should stand: Near the boom, arm, or hydraulic linkages of a rock breaker, Between two pieces of machinery, Inside blind zones of a backhoe
- Supervisors, fitters, and maintenance personnel must stand in **safe**, **elevated**, **and clearly visible locations**.

Effective Communication & Coordination Protocol

- Use a **designated Banksman / Spotter** equipped with: Hi-vis jacket, Whistle, Walkie-talkie
- Banksman controls machine movement using standard hand signals or radio.

^{*}Safety Alert, a tool utilized by DGMS, informs the mining industry about potential safety issues and offers recommendations to prevent such incident.